



Electrical and physical specifications

Supply configuration	3-Phase Wye
Input voltage	379 V
Nominal output voltage	417 V
Calculated output at stated input	416.90 V
Rated continuous output current	45.9 A
Approx. input current at rated load	50.490 A
Capacity at calculated output	33.14 kVA
Connection diagram	K2
Base transformer part	TX-B3-015K-124202
Number of base transformers	3
Rating of each base	1500 VA
Base primary / secondary windings	120/240 V / 12/24 V
Dimensions per enclosure (W x D x H)	5.43 x 4.49 x 10.87 in
Weight per enclosure	34 lb
Total base-transformer weight	102 lb
Winding / enclosure	Aluminum / NEMA 3R
Rated frequency	50/60 Hz

Installation and rating notes

Use the connection sheet with this exact base construction. Do not select wiring by voltage alone.

Nominal output is an application label. Actual output varies with supply voltage and load.

The current limit shown above governs; the ordering SKU is retained for traceability.

Confirm equipment current, motor starting requirements and duty before installation.

A supply neutral is required and must be carried through. These connections do not create a neutral.

Installation must be performed by qualified personnel. Disconnect and verify absence of power.

Diagram K2 | 379 V input to 417 V nominal output


Three phase wye | Primary series / secondary series | Boost

Continuous output rating: 45.9 A | Calculated output: 416.90 V

1. Join X2 and X3 on each unit.
2. Join H2 and H3 on each unit.
3. Connect 417 V OUTPUT A to X4 on Unit 1.
4. Connect 417 V OUTPUT B to X4 on Unit 2.
5. Connect 417 V OUTPUT C to X4 on Unit 3.
6. Connect 379 V INPUT A to X1 and H4 on Unit 1.
7. Connect 379 V INPUT B to X1 and H4 on Unit 2.
8. Connect 379 V INPUT C to X1 and H4 on Unit 3.
9. Connect INPUT and OUTPUT N to H1 on Unit 1.
10. Bridge N connections between all units.

BASE: 3 x TX-B3-015K-124202 | 1500 VA each

Use this diagram only with 120/240 V primary / 12/24 V secondary.

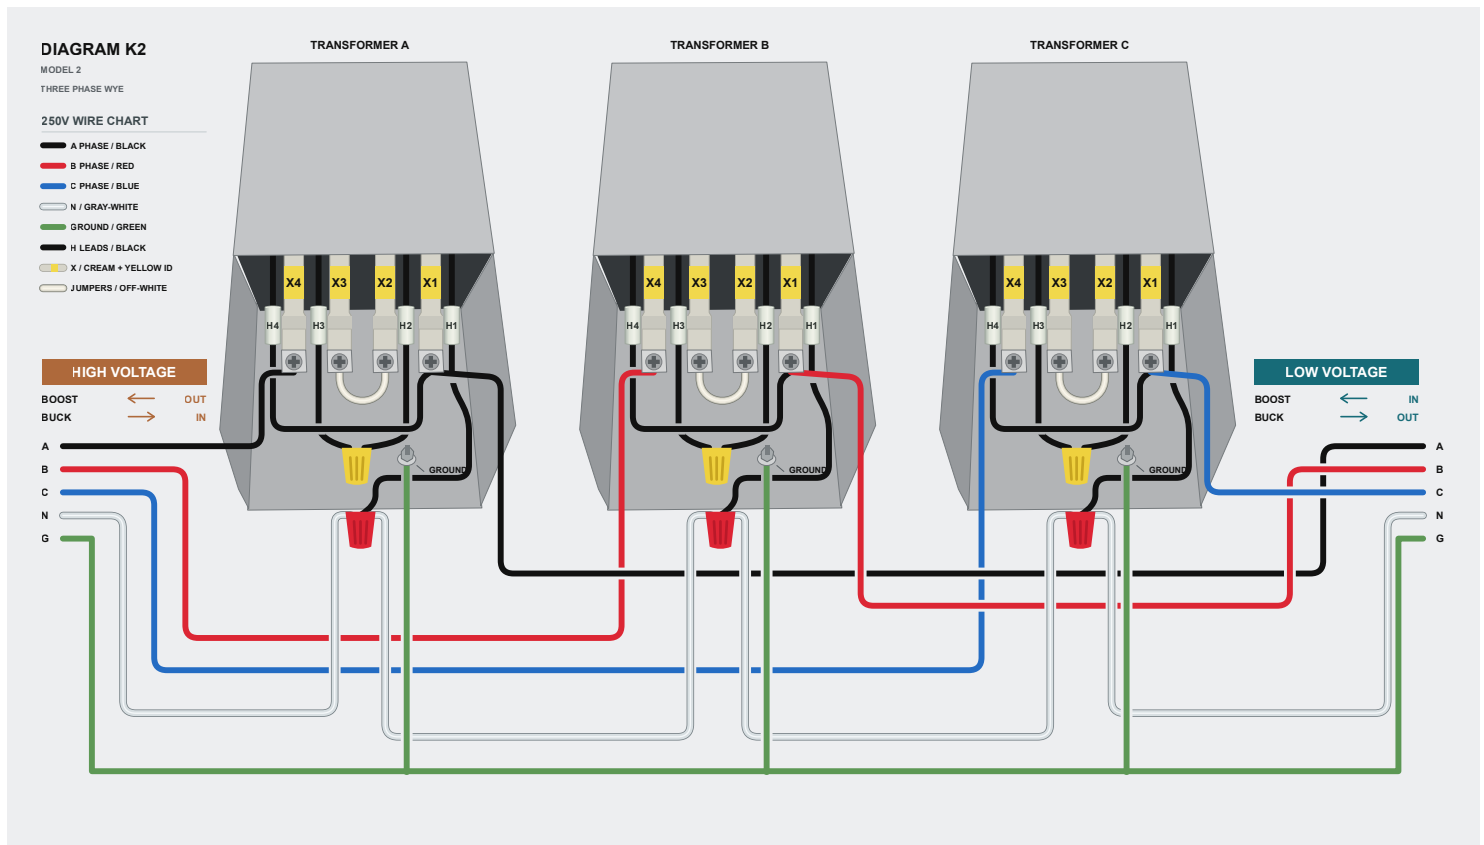

Drawing: LOW VOLTAGE = 379 V INPUT; HIGH VOLTAGE = 417 V OUTPUT.

Disconnect power and verify de-energized before wiring. Bond every enclosure to equipment ground.

Follow the terminal identifiers shown; H2/H3 and X2/X3 differ from some other manufacturers.

Verify input and all output voltages before connecting the load. No circuit isolation is provided.

A supply neutral is required and must be carried through; no neutral is created.