

## Diagram G2 | 480 V input to 528 V nominal output


Three phase delta | Primary series / secondary series | Boost

**Continuous output rating: 18.22 A | Calculated output: 528.00 V**

1. Join X2 and X3 on each unit.
2. Join H2 and H3 on each unit.
3. Connect 528 V OUTPUT A to X4 on Unit 1.
4. Connect 528 V OUTPUT C to X4 on Unit 2.
5. Connect 480 V INPUT A to X1 and H4 on Unit 1.
6. Connect 480 V INPUT C to X1 and H4 on Unit 2.
7. Connect INPUT and OUTPUT B to H1 on Unit 1.
8. Bridge B connections between all units.

**BASE: 2 x TX-B3-010K-115216 | 1000 VA each**

Use this diagram only with 240/480 V primary / 24/48 V secondary.

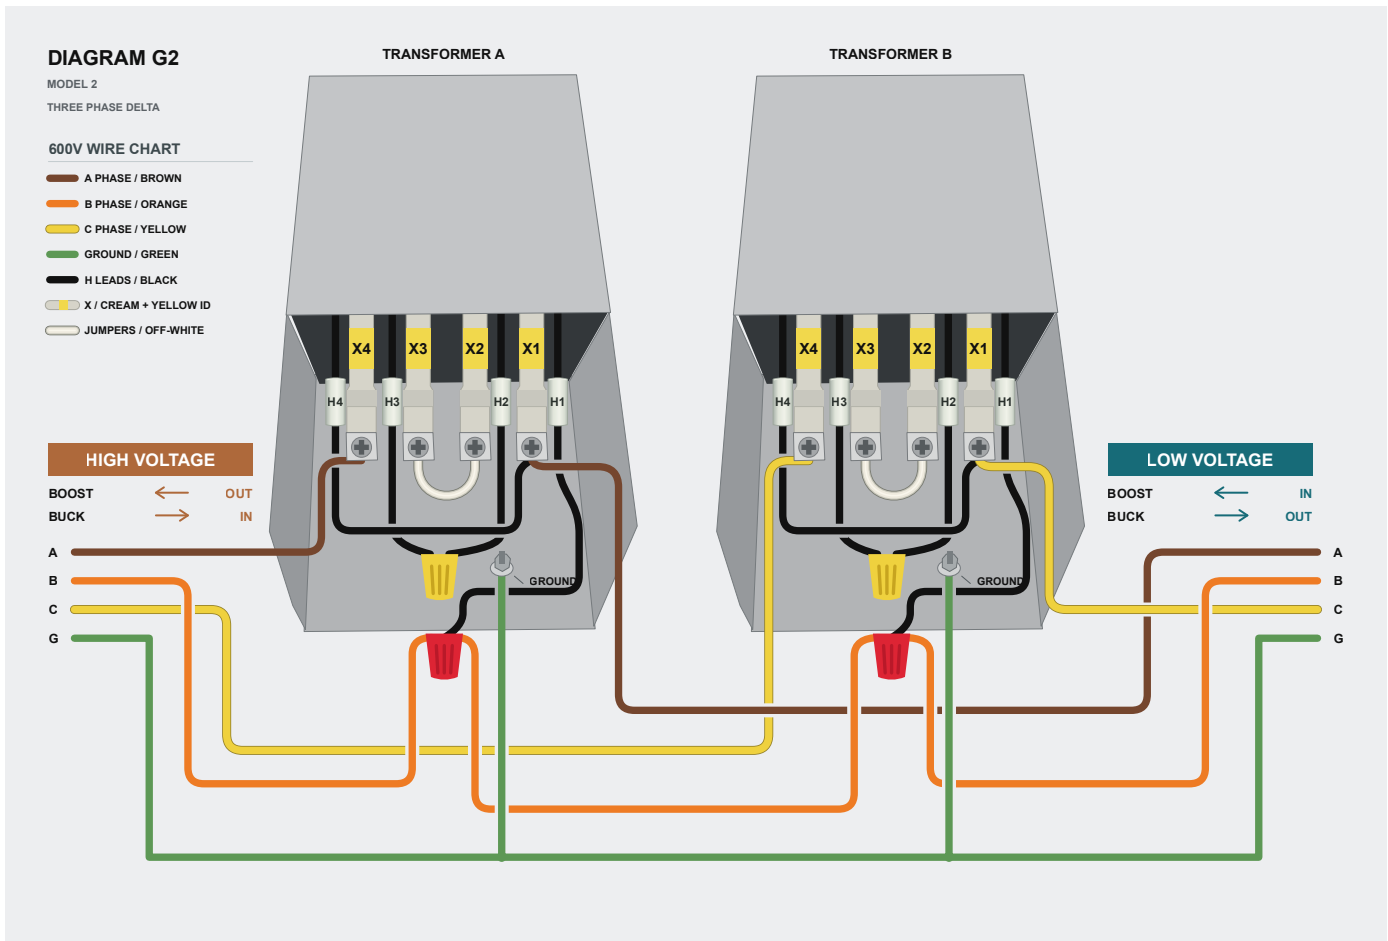

**Drawing: LOW VOLTAGE = 480 V INPUT; HIGH VOLTAGE = 528 V OUTPUT.**

Disconnect power and verify de-energized before wiring. Bond every enclosure to equipment ground.

Follow the terminal identifiers shown; H2/H3 and X2/X3 differ from some other manufacturers.

Verify input and all output voltages before connecting the load. No circuit isolation is provided.

This connection does not create a neutral. Installation must be performed by a qualified electrician.