



Electrical and physical specifications

Supply configuration	3-Phase Delta
Input voltage	400 V
Nominal output voltage	440 V
Calculated output at stated input	440.00 V
Rated continuous output current	16.04 A
Approx. input current at rated load	17.644 A
Capacity at calculated output	12.22 kVA
Connection diagram	G2
Base transformer part	TX-B3-010K-115216
Number of base transformers	2
Rating of each base	1000 VA
Base primary / secondary windings	240/480 V / 24/48 V
Dimensions per enclosure (W x D x H)	5.43 x 4.49 x 10.08 in
Weight per enclosure	27 lb
Total base-transformer weight	54 lb
Winding / enclosure	Aluminum / NEMA 3R
Rated frequency	50/60 Hz

Installation and rating notes

Use the connection sheet with this exact base construction. Do not select wiring by voltage alone.

Nominal output is an application label. Actual output varies with supply voltage and load.

The current limit shown above governs; the ordering SKU is retained for traceability.

Confirm equipment current, motor starting requirements and duty before installation.

Autotransformer connections provide no electrical isolation and do not create a neutral.

Installation must be performed by qualified personnel. Disconnect and verify absence of power.

Diagram G2 | 400 V input to 440 V nominal output


Three phase delta | Primary series / secondary series | Boost

Continuous output rating: 16.04 A | Calculated output: 440.00 V

1. Join X2 and X3 on each unit.
2. Join H2 and H3 on each unit.
3. Connect 440 V OUTPUT A to X4 on Unit 1.
4. Connect 440 V OUTPUT C to X4 on Unit 2.
5. Connect 400 V INPUT A to X1 and H4 on Unit 1.
6. Connect 400 V INPUT C to X1 and H4 on Unit 2.
7. Connect INPUT and OUTPUT B to H1 on Unit 1.
8. Bridge B connections between all units.

BASE: 2 x TX-B3-010K-115216 | 1000 VA each

Use this diagram only with 240/480 V primary / 24/48 V secondary.

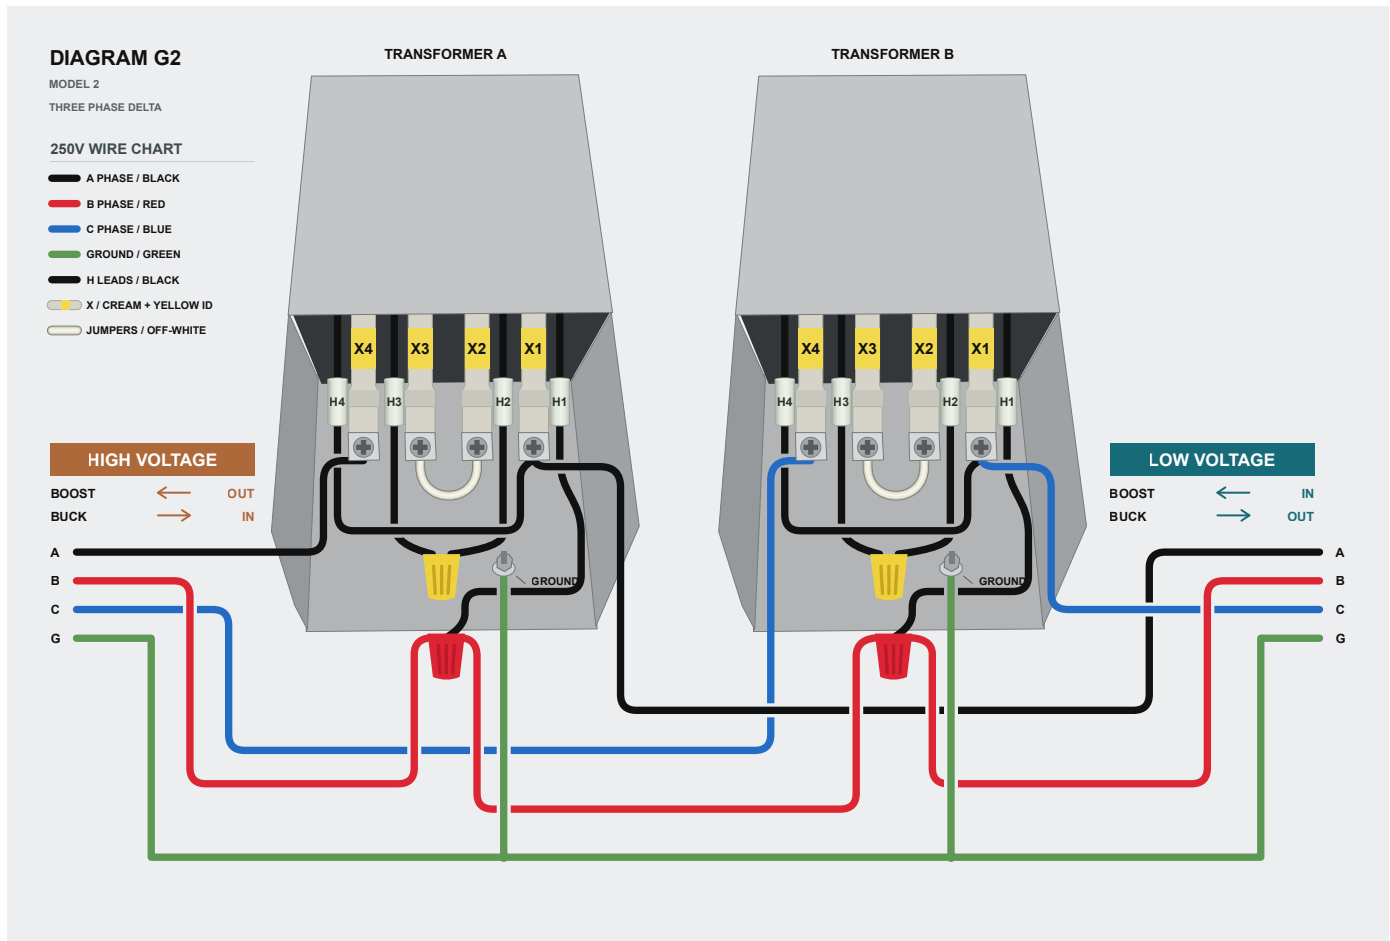

Drawing: LOW VOLTAGE = 400 V INPUT; HIGH VOLTAGE = 440 V OUTPUT.

Disconnect power and verify de-energized before wiring. Bond every enclosure to equipment ground.

Follow the terminal identifiers shown; H2/H3 and X2/X3 differ from some other manufacturers.

Verify input and all output voltages before connecting the load. No circuit isolation is provided.

This connection does not create a neutral. Installation must be performed by a qualified electrician.