

### Diagram G2 | 220 V input to 191 V nominal output


Three phase delta | Primary series / secondary series | Buck

**Continuous output rating: 2.51 A | Calculated output: 194.12 V**

1. Join X2 and X3 on each unit.
2. Join H2 and H3 on each unit.
3. Connect 220 V INPUT A to X4 on Unit 1.
4. Connect 220 V INPUT C to X4 on Unit 2.
5. Connect 191 V OUTPUT A to X1 and H4 on Unit 1.
6. Connect 191 V OUTPUT C to X1 and H4 on Unit 2.
7. Connect INPUT and OUTPUT B to H1 on Unit 1.
8. Bridge B connections between all units.

**BASE: 2 x TX-B1-010H-124210 | 100 VA each**

Use this diagram only with 120/240 V primary / 16/32 V secondary.

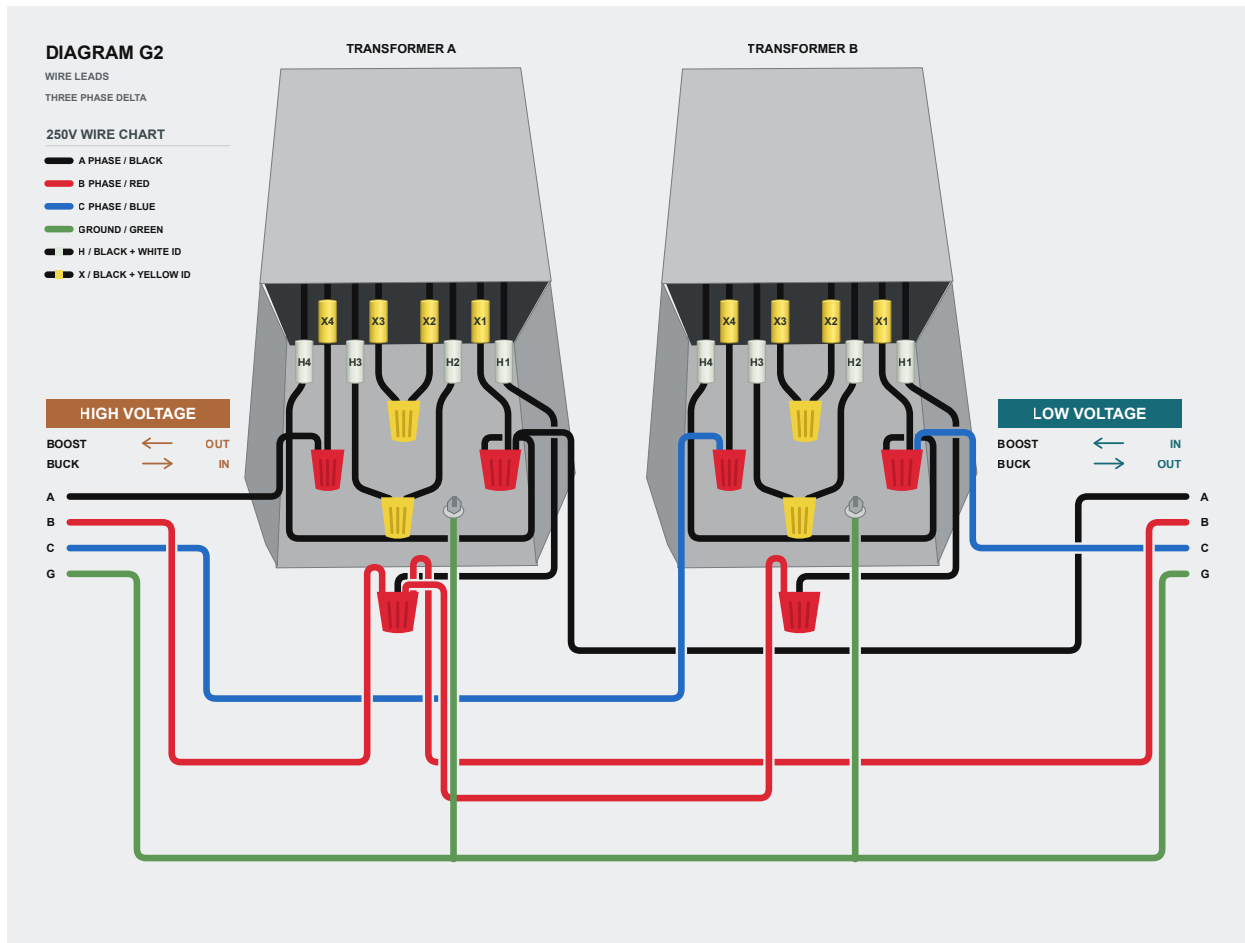

**Drawing: LOW VOLTAGE = 191 V OUTPUT; HIGH VOLTAGE = 220 V INPUT.**

Disconnect power and verify de-energized before wiring. Bond every enclosure to equipment ground.

Follow the terminal identifiers shown; H2/H3 and X2/X3 differ from some other manufacturers.

Verify input and all output voltages before connecting the load. No circuit isolation is provided.

This connection does not create a neutral. Installation must be performed by a qualified electrician.