

Summary

Three-phase delta buck-boost transformer. Steps up 200V to 220V at 14.6 amps continuous output. 5.563 kVA capacity. NEMA 3R enclosed, cETLus listed, wall mount.

Product Description

This unit corrects a 200V three phase building supply to 220V delta at the point of use, permanently, without modifying the building's electrical service. Designed for equipment rated 220V that is installed on a 200V system experiencing undervoltage from the utility.

Configured as an open delta autotransformer, the unit handles only the difference between input and output and not the full load. This is why a 14.6-amp buck-boost transformer is significantly smaller and lighter than a 14.6-amp isolation transformer. The encapsulated core construction eliminates audible hum and provides stable thermal performance under continuous duty.

Features a removable wiring compartment door, removable knockout plate, and six NPT knockouts for flexible conduit entry. Surface mounting bracket for easy wall mount installations.



TX-BB-200D-220D-15A — NEMA 3R Encapsulated, cETLus Listed

Specifications

Phase	Three Phase Delta (3-PH), AC	Transformer Type	Buck/Boost
Capacity	5.563 kVA	Configuration	Encapsulated Autotransformer
Primary Voltage	200V	Primary Termination	Lead Wires & Terminal Lugs
Primary Amperage	16.06A	Secondary Termination	Lead Wires & Terminal Lugs
Secondary Voltage	220V	Termination Access	(6) 1/2" NPT Hubs
Secondary Amperage	14.6A	Winding Material	Aluminum
Maximum Primary OCP	20A	Enclosure Material	Steel
Frequency	50/60 Hz	Finish Color	ANSI 70 Light Grey
Insulation	180°C	Weight	28 lbs
Temperature Rise	115°C	Dimensions	10.3 x 3.86 x 9.25

Ratings & Certifications

- Listed for United States
- NEMA 3R Indoor/Outdoor Enclosure
- Built to UL-5085 Standards
- CE Certified
- Listed for Canada
- Epoxy Resin Encapsulated
- RoHS Compliant



Common Applications

- HVAC & Minisplit
- Loads CNC Machines
- Pump Stations
- Packaging Machines
- Commercial Kitchen Equipment
- Motor Loads
- EV Chargers
- Server Racks & IT Equipment
- Refrigeration & Walk-in
- Coolers Fans & Blowers
- Conveyor Systems
- Overhead Doors


Important: Buck-boost transformers applied as autotransformers do not provide circuit isolation and do not create a neutral. Contact us if your application requires isolation or neutral creation.

Connection Guide

1. Connect X2 and X3 together for each transformer
2. Connect High Voltage PHASE A to X4 on transformer A
3. Connect High Voltage PHASE C to X4 on transformer B
4. Connect Low Voltage PHASE A to X1, H4, H3 on transformer A
5. Connect Low Voltage PHASE C to X1, H4, H3 on transformer B
6. Connect High & Low Voltage PHASE B to H1 and H2
7. Bridge H1 and H2 connections between Transformers A & B

DIAGRAM F2

HIGH VOLTAGE

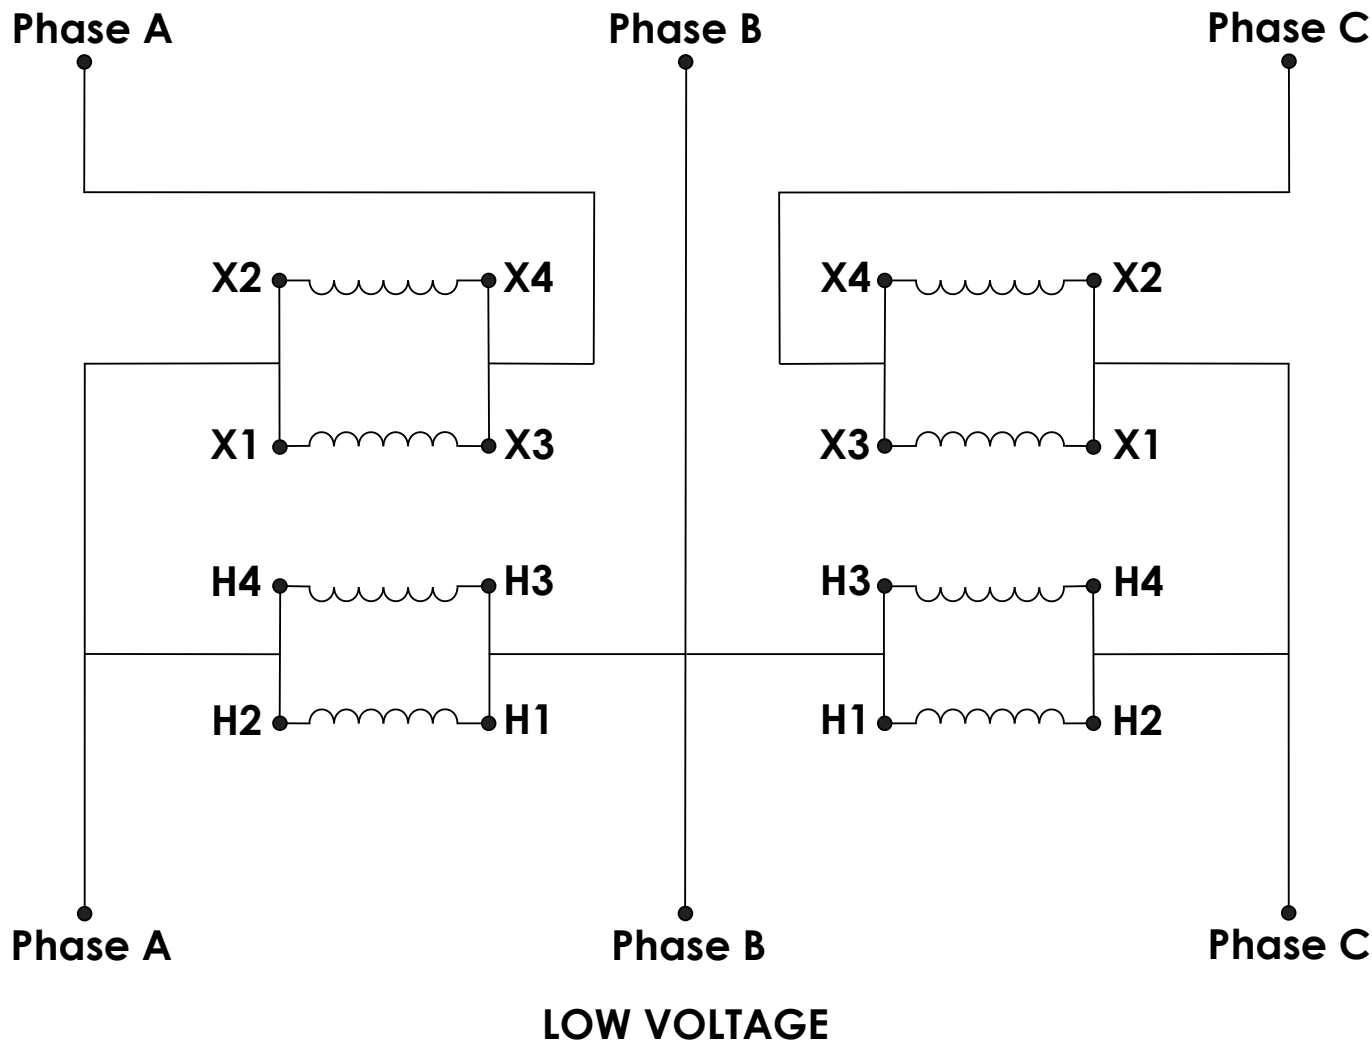



TX-BB-200D-220D-15A — NEMA 3R Encapsulated, cETLus Listed



Base Knockouts — (4) $\frac{3}{4}$ " NPT



Side View



Rear View — Surface Mount Bracket



Wiring Compartment — Terminal Leads



Interior — Epoxy Resin Encapsulated Core